


Document number:	<u>15-1191-EN</u>	Report date:	<u>10/09/2015</u>
Fabric reference:	<u>Genial</u> <u>(beige)</u>	Date analyses:	<u>17/06/2015 - 24/06/2015</u>
Customer:	<u>BRU Textiles</u> <u>Satenrozen 2A</u> <u>B-2550 Kontich</u>	Place analyses:	<u>Labotex</u>
		Date of request:	<u>3/06/2015</u>
		Samples received	<u>2/06/2015</u>

Testing and conditioning in standard atmosphere, T (20+/-2)°C and RH (65+/-4)%

(SC as TM)

Specification	Results	Remarks	!																																																																													
<p><b>Burning behaviour of fabrics for curtains &amp; drapes</b></p> <p>EN 13773</p> <p>conditioning min. 24h in standard atmosphere</p> <p>used gas: propane flame height: 40mm bottom edge ignition</p> <p>flow chart EN 13773</p> 	<p>a) <u>EN 1101</u></p> <p>Test EN1101 is performed after subjecting the fabric to 1 washing cycle, based on the recommended washing instruction.</p> <table border="1"> <thead> <tr> <th>flame application time</th> <th>warp</th> <th>weft</th> </tr> </thead> <tbody> <tr><td>1s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>2s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>3s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>4s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>5s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>10s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>15s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>20s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>20s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>20s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>20s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>20s</td><td>no ignition</td><td>no ignition</td></tr> <tr><td>20s</td><td>no ignition</td><td>no ignition</td></tr> </tbody> </table> <p>Mean ignition time warp: <u>NA</u> Mean ignition time weft: <u>NA</u> Minimum ignition time: <u>NA</u></p> <p>b) <u>EN 13772 before washing</u></p> <table border="1"> <thead> <tr> <th>warp</th> <th>face</th> <th>reverse</th> <th>face</th> <th>face</th> </tr> </thead> <tbody> <tr><td>1st marker thread severed</td><td>no</td><td>no</td><td>no</td><td>no</td></tr> <tr><td>2nd marker thread severed</td><td>no</td><td>no</td><td>no</td><td>no</td></tr> <tr><td>3rd marker thread severed</td><td>no</td><td>no</td><td>no</td><td>no</td></tr> <tr><td>time to severance 3rd marker thread (s)</td><td>-</td><td>-</td><td>-</td><td>-</td></tr> <tr><td>destroyed length (mm)</td><td>124</td><td>116</td><td>114</td><td>115</td></tr> <tr><td>flaming debris</td><td>no</td><td>no</td><td>no</td><td>no</td></tr> </tbody> </table>	flame application time	warp	weft	1s	no ignition	no ignition	2s	no ignition	no ignition	3s	no ignition	no ignition	4s	no ignition	no ignition	5s	no ignition	no ignition	10s	no ignition	no ignition	15s	no ignition	no ignition	20s	no ignition	no ignition	20s	no ignition	no ignition	20s	no ignition	no ignition	20s	no ignition	no ignition	20s	no ignition	no ignition	20s	no ignition	no ignition	warp	face	reverse	face	face	1st marker thread severed	no	no	no	no	2nd marker thread severed	no	no	no	no	3rd marker thread severed	no	no	no	no	time to severance 3rd marker thread (s)	-	-	-	-	destroyed length (mm)	124	116	114	115	flaming debris	no	no	no	no		<input type="checkbox"/>
flame application time	warp	weft																																																																														
1s	no ignition	no ignition																																																																														
2s	no ignition	no ignition																																																																														
3s	no ignition	no ignition																																																																														
4s	no ignition	no ignition																																																																														
5s	no ignition	no ignition																																																																														
10s	no ignition	no ignition																																																																														
15s	no ignition	no ignition																																																																														
20s	no ignition	no ignition																																																																														
20s	no ignition	no ignition																																																																														
20s	no ignition	no ignition																																																																														
20s	no ignition	no ignition																																																																														
20s	no ignition	no ignition																																																																														
20s	no ignition	no ignition																																																																														
warp	face	reverse	face	face																																																																												
1st marker thread severed	no	no	no	no																																																																												
2nd marker thread severed	no	no	no	no																																																																												
3rd marker thread severed	no	no	no	no																																																																												
time to severance 3rd marker thread (s)	-	-	-	-																																																																												
destroyed length (mm)	124	116	114	115																																																																												
flaming debris	no	no	no	no																																																																												

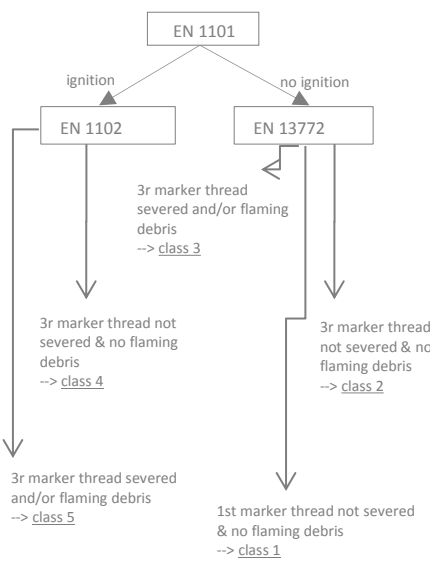

# Report EN13773

Document number:	<u>15-1191-EN</u>	Report date:	<u>10/09/2015</u>
Fabric reference:	<u>Genial</u> <u>(beige)</u>	Date analyses:	<u>17/06/2015 - 24/06/2015</u>
		Place analyses:	<u>Labotex</u>
		Date of request:	<u>3/06/2015</u>
Customer:	<u>BRU Textiles</u> <u>Satenrozen 2A</u> <u>B-2550 Kontich</u>	Samples received	<u>2/06/2015</u>

Testing and conditioning in standard atmosphere, T (20+/-2)°C and RH (65+/-4)%

(SC as TM)


Specification	Results					Remarks	!
	weft						
	face	reverse	face	face			
1st marker thread severed	no	no	no	no			
2nd marker thread severed	no	no	no	no			
3rd marker thread severed	no	no	no	no			
time to severance 3rd marker thread (s)	-	-	-	-			
destroyed length (mm)	129	105	125	141			
flaming debris	no	no	no	no			
c) <u>EN 13772 after washing</u>							
<i>This washing procedure consists of 12 cycles according to standard ISO6330.</i>							
	warp						
	face	reverse	reverse	reverse			
1st marker thread severed	no	no	no	no			
2nd marker thread severed	no	no	no	no			
3rd marker thread severed	no	no	no	no			
time to severance 3rd marker thread (s)	-	-	-	-			
destroyed length (mm)	102	107	109	126			
flaming debris	no	no	no	no			
	weft						
	face	reverse	face	face			
1st marker thread severed	no	no	no	no			
2nd marker thread severed	no	no	no	no			
3rd marker thread severed	no	no	no	no			
time to severance 3rd marker thread (s)	-	-	-	-			
destroyed length (mm)	124	119	139	121			
flaming debris	no	no	no	no			

# Report EN13773

Document number:	<u>15-1191-EN</u>	Report date:	<u>10/09/2015</u>
Fabric reference:	<u>Genial</u> <u>(beige)</u>	Date analyses:	<u>17/06/2015 - 24/06/2015</u>
Customer:	<u>BRU Textiles</u> <u>Satenrozen 2A</u> <u>B-2550 Kontich</u>	Place analyses:	<u>Labotex</u>
		Date of request:	<u>3/06/2015</u>
		Samples received	<u>2/06/2015</u>

Testing and conditioning in standard atmosphere, T (20+/-2)°C and RH (65+/-4)%

(SC as TM)

Specification	Results	Remarks	!
	c) <u>classification</u>  class 1 <u>  x  </u> class 2            _____ class 3            _____ class 4 or 5      _____		

**Labotex certifies that the results mentioned in this report are obtained after testing in accordance with the procedure and equipment specified by the concerned standards, unless noted differently.**



Joeri Neys - Laboratory Manager

Labotex has the competence to perform tests in accordance with the requirements of standard NBN EN ISO/IEC 17025. The scope of this accreditation can be obtained on request.

The results in this report only relate to the tested items.

Samples will be returned to the customer with the certificate, if possible. Samples will not be retained, unless specified by the customer. Retained samples will be kept for maximum one year unless a specific retention period is necessary.

This report can not be copied unless in its complete form and with written approval of Labotex (Kontich).

Sampling is performed by the customer. Fabric analysed as received